

LAND SURVEY REFERENCE REPORT
Department of Archives
Kansas State Historical Society
425 SW Sixth Avenue, Topeka, KS 66615-1099
(785) 272-8681 Ext. 322 FAX (785) 272-8682

FOR OFFICIAL USE ONLY
FILED
090728
OCT 27 2009
Matthew Veatch
STATE ARCHIVIST

Land Surveyor: Ernest Cantu Jr.
Company: Professional Engineering Consultants
Street Address: 303 South Topeka
City, State: Wichita, KS
Zip Code: 67202

L.S. Reg. Number: 1407
Project Number: 60X-05735-008
Telephone Number: (316)262-6457
Date of Survey: AUGUST 10, 2009
County of Survey: SALINE

This report is filed as a (check only one):

- ☒ **SURVEY REFERENCE REPORT (K.S.A. 58-2011a).** ☐ **NOTICE OF ENDANGERMENT ACTIVITY (K.S.A. 58-2011b).**
There is a \$4.00 per corner filing fee, which must accompany the Land Survey Reference Report.
- ☐ **NOTICE OF COMPLETION OF ENDANGERMENT ACTIVITY AND REPORT OF RESTORATION (K.S.A. 58-2011c).**
This may only be filed after filing a prior **NOTICE OF ENDANGERMENT ACTIVITY**. There is no filing fee.
Endangerment report was filed on _____.

LOCATION CODE OF MARKER IN TOWNSHIP (see illustration below): 017

Legal Description: WEST 1/4 CORNER Section: 30 Township: 16 S Range: 3 W

Survey Datum (if known): NAD83 (1502) North: 2,028,558.61 FT East: 1,539,852.91 FT

Corner Status Prior to Survey: ☒ Existent ☐ Obliterated ☐ Lost ☐ Endangered

Monument Condition: ☒ Found ☐ Set ☐ Reset ☐ Found Record

Detailed Monument Description: #5 REBAR WITH 2" DIA ALUMINUM CAP 0.8' DEEP

REFERENCE MARKS AND MEASUREMENTS: (Please, no symbols or abbreviations.)

NOTE: ALL MEASUREMENTS ARE ☒ HORIZONTAL ☐ SLOPED UNLESS NOTED OTHERWISE.

22. 25 FT ESE TO SPIKE IN TOP OF HEDGE STUMP 1 FT TALL

26.62 FT NE TO PK NAIL IN NW CORNER OF 10" DIA. WEST END FENCE POST

33,33 FT SW TO SPIKE IN TOP OF FENCE POST

21.16 FT W TO PK NAIL IN ~~THE~~ NORTH FACE OF FENCE CORNER POST

IN LINE WITH FENCE WEST

15 FT N. TO LINE OF FENCE EAST

276
DETAILED METHOD OF RECOVERY OR ESTABLISHMENT:

Use of past land survey reference reports of record.

IDENTIFYING A MARKER


To identify the location of a marker in a township, use the following standard alpha-numeric grid to designate an identifier for a given section corner or intersection.

For Example: The southwest corner of Section 26 would be designated by the identifier "17V". This is the "LOCATION CODE OF MARKER IN TOWNSHIP".

Sec 6	Sec 5	Sec 4	Sec 3	Sec 2	Sec 1
Sec 7	Sec 8	Sec 9	Sec 10	Sec 11	Sec 12
Sec 18	Sec 17	Sec 16	Sec 15	Sec 14	Sec 13
Sec 19	Sec 20	Sec 21	Sec 22	Sec 23	Sec 24
Sec 30	Sec 29	Sec 28	Sec 27	Sec 26	Sec 25
Sec 31	Sec 32	Sec 33	Sec 34	Sec 35	Sec 36

01 03 05 07 09 11 13 15 17 19 21 23 25

The original signature and date shall be across the Land Surveyor's Professional seal.

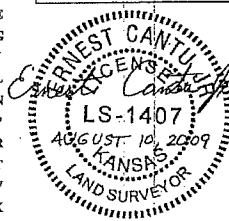

Surveyor's signature & date

APPENDIX A: SAMPLE COPIES OF LSRR

LAND SURVEY REFERENCE REPORT

FILED

DEC 24 1997

Department of Archives
Kansas State Historical Society
6425 SW Sixth Avenue
Topeka, KS 66615-1099
(913) 272-8681, x 322

DEC 12 1998

DEC 30 1997
112163
Patricia A. Michels
STATE ARCHIVIST

Surveyor <u>LLOYD K. DORZWEILER</u>	L.S. Reg. No. <u>895</u>
Address <u>606 ELDERADO DR.</u>	Job No. <u>9703</u>
	Telephone <u>316-663-8002</u>
Date of Survey <u>17 Nov 97</u>	
Brief description of type and boundary of survey <u>SURVEY OF 10⁰⁰ ACRES TRACT IN</u> <u>3/4 NW 1/4 SEC. 32-15² 3^W</u>	
This report is for Twp. <u>16^S</u> Rng. <u>3^W</u> of 6th PM in <u>SALINE</u> County, Kansas	
This report is filed as a (check only one):	
<input checked="" type="checkbox"/> SURVEY REFERENCE REPORT (K.S.A. 58-2011a)	
There is a \$1 filing fee for each corner filed with a minimum fee of \$5 per form. Each form may contain reports on as many as 9 corners in the same township. Additional townships or corners require additional forms.	
<input type="checkbox"/> NOTICE OF ENDANGERMENT ACTIVITY (K.S.A. 58-2011b)	
There is a \$1 filing fee for each corner filed with a minimum fee of \$5 per form. Each form may contain reports on as many as 9 corners in the same township.	
<input type="checkbox"/> NOTICE OF COMPLETION OF ENDANGERMENT ACTIVITY AND REPORT OF RESTORATION (K.S.A. 58-2011c)	
This may only be filed after filing a NOTICE OF ENDANGERMENT ACTIVITY. There is no filing fee. Endangerment report filed _____	

LOCATION OF MARKER IN TOWNSHIP (see illustration): <u>5 A</u>	
Legal Description: <u>NE Cor</u>	Sec. <u>6</u> Twp. <u>16^S</u> Rng. <u>3^W</u>
Survey Datum (if known): _____	North _____ East _____
Corner Status <u>EXISTENT</u>	Monument Condition <u>FOUND</u>
(Existent/Obliterated/Lost/Endangered) (Found/Record/Set/Reset)	
Monument Description <u>1/2" I.P. 0.5 DEEP 2.42^{FT} S. of 3rd STO. BAR.</u>	
REFERENCE MARKS AND MEASUREMENTS	
R1 <u>32.30</u>	<u>NW</u> <u>20d SPK</u> <u>IN P.P.</u>
R2 <u>29.40</u>	<u>NNE</u> <u>"</u> <u>"</u> <u>UGT MARKER POST</u>
R3 <u>44.05</u>	<u>SE</u> <u>TOP</u> <u>CTR. UGT PEDESTAL</u>
R4 <u>92.15</u>	<u>WSW</u> <u>"</u> <u>"</u> <u>"</u>

LOCATION OF MARKER IN TOWNSHIP (see illustration): <u>1 A</u>	
Legal Description: <u>NW Cor</u>	Sec. <u>6</u> Twp. <u>16^S</u> Rng. <u>3^W</u>
Survey Datum (if known): _____	North _____ East _____
Corner Status <u>EXISTENT</u>	Monument Condition <u>FOUND</u>
(Existent/Obliterated/Lost/Endangered) (Found/Record/Set/Reset)	
Monument Description <u>1/2" I.P. 0.5 DEEP 2.25^{FT} N. of 3rd STO. BAR.</u>	
REFERENCE MARKS AND MEASUREMENTS	
R1 <u>30.60</u>	<u>NW</u> <u>20d SPK</u> <u>IN P.P.</u>
R2 <u>30.75</u>	<u>NNE</u> <u>"</u> <u>"</u> <u>IN TOP OFP</u>
R3 <u>57.35</u>	<u>SW</u> <u>"</u> <u>"</u> <u>FP</u>
R4 <u>57.45</u>	<u>SE</u> <u>TOP CTR. PIPELINE MARKER POST.</u>

APPENDIX A: SAMPLE COPIES OF LSRR

SURVEYOR'S REPORT

I, Lloyd P. Dorzweiler, a Registered Land Surveyor in the State of Kansas performed a survey of portions of Section 32, Township 15 South, Range 3 West of the 6th Principal Meridian, Saline County, Kansas on November 17, 1997.

Research of records at the Saline County Engineer's Office provided the following information:

- 1) Reference ties for section corners for said Section 32 and the surrounding sections.
 - a) Ties for the northwest corner Section 32.
 - b) Ties for the north-quarter corner Section 32.
 - c) Ties for the northeast corner Section 32.
 - d) Ties for the southeast corner Section 32.
 - e) Ties for the southwest corner Section 31
 - f) W.P.A. references ties showed that no stones were found at the east-quarter corner, south-quarter corner, west-quarter corner, and southwest corner of said Section 32, nor at the south-quarter corner of Section 31, T. 15 S., R. 3 W.
- 2) Copy of field notes for a survey of the East-half of said Section 32 made in 1907.

Research of records at the Saline County Register of Deed's Office provided the following information:

- 1) G.L.O. notes for said Section 32 and surrounding sections.
- 2) Road right-of-way widths for said Section 32.

The field work began with locating section corners for which ties were available. Only one corner was found from the ties, that being the northwest corner of Section 32. All other Section 32 monument ties have been destroyed. One-half inch rebar were found at the northeast and northwest corners of Section 6, T. 16 S., R. 3 W.

Using a backhoe I searched for the missing corners by excavating a hole in excess of 3 feet deep and an area 6 to 8 feet in diameter. No stones were found at any of the locations.

I split the existing improvements, i.e. roads and fences, and set temporary control points at each section corner and quarter corner locations around Section 32, the southwest corner of Section 31, and also at the Northeast corner of Section 5, T. 16 S., R. 3 W. Measurements were taken between all found monuments and the temporary control points. I compared the distances between my measurements, G.L.O. notes, and the 1907 survey. The alignment and distances between the temporary control points along the south line of Sections 31 and 32 fit very well. Alignment fit within 0.5 foot and distances within 0.25 foot for prorated split. The distances along the north line of the Northeast-quarter of Section 32 fit the 1907 survey within 2.81 feet. The distances between the temporary control points and the found Northeast and Northwest corners of Section 6, T. 16 S., R. 3 W. fit the G.L.O. dimensions well within reason, although the found monuments missed

APPENDIX A: SAMPLE COPIES OF LSRR

the temporary control point alignment along the 3rd Standard Parallel. The Northwest corner of Section 6 fell 2.25 feet north, while the Northeast corner of Section 6 fell 2.42 feet south of the temporary control point alignment.

It is my opinion that the missing monuments were obliterated and not lost. I reestablished the Northeast and Southeast corner at the temporary control point locations for Section 32. I reestablished the Southwest corner of Section 32 by single proportionate measure between the temporary control points at the Southeast corner of Section 32 and the Southwest corner of Section 31. I reestablished the North-quarter corner, East-quarter corner, South-quarter corner, and West-quarter corner locations by single proportionate measure. The reestablished quarter corner monuments fit ancient hedge and fence lines quite well. All corner locations are monumented with 5/8" x 24" rebar and plastic caps stamped "RLS 885".

References ties were taken for all section and quarter-section corner monuments found and reestablished.


A ten acre parcel was surveyed in the South-half of the Northwest-quarter of said Section 32 and monumented with 5/8" X 24" rebar and plastic caps stamped "RLS 885".

Lloyd P. Dorzweiler

Lloyd P. Dorzweiler, R.L.S. 885

Dated: December 18, 1997.

APPENDIX A: SAMPLE COPIES OF LSRR

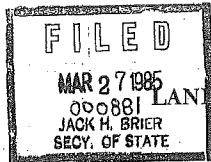

JACK H. BRIER
Secretary of State
Second Floor, State Capitol
Topeka, Kansas 66612

000001 10 2101 03-23-85 20.00
44 LAND SURV FILE 3 20.00

Surveyor: <u>BERNIE KRIEGBAUM</u>	L.S. Reg. No. <u>77445</u>
Address: <u>325 W. ELLSWORTH</u>	Job No. <u>913-8277887</u>
Date of Survey: <u>MARCH 23, 1985</u>	Telephone: <u>913-8277887</u>
Brief description of type and boundary of survey: <u>12 ACRE TRACT CONTAINING OUT- BUILDINGS AND PASTURE</u>	
This report is for Twp. <u>16-S</u> Rng. <u>3-W</u> 6th PM County <u>SALINE</u>	
This report is filed as a (check only one):	
<input checked="" type="checkbox"/> SURVEY REFERENCE REPORT (K.S.A. 58-2001a)	
There is a \$20 filing fee for each form. Each form may contain reports on as many as 12 corners in the same township. Additional townships or corners require additional forms.	
<input type="checkbox"/> NOTICE OF ENDANGERMENT ACTIVITY (K.S.A. 58-2001b)	
There is a \$20 filing fee for each form. Each form may contain reports on as many as 12 corners in the same township.	
<input type="checkbox"/> NOTICE OF COMPLETION OF ENDANGERMENT ACTIVITY AND REPORT OF RESTORATION (K.S.A. 58-2001c)	
This may only be filed after filing a NOTICE OF ENDANGERMENT ACTIVITY. There is no filing fee. Endangerment report filed.	

LOCATION OF MARKER IN TOWNSHIP (see illustration): <u>11N</u>	
Legal Description: <u>N.W. COR.</u> Sec. <u>14</u> Twp. <u>16-S</u> Rng. <u>3-W</u>	
Survey Datum (if known): _____	North _____ East _____
Corner Status: <u>EXISTENT</u>	Monument Condition: <u>FOUND</u>
(Existent/Obliterated/Lost/Endangered)	(Found/Record/Set/Reset)
Monument Description: <u>CADAstral MARKER</u>	
REFERENCE MARKS AND MEASUREMENTS	
R1 <u>NAIL IN POWER POLE</u>	<u>54' 10" N.W.</u>
R2 <u>NAIL IN POWER POLE</u>	<u>51' 6" N.E.</u>
R3 <u>S. SIDE OF W. WINGWALL</u>	<u>26' 5" N.W.</u>
R4	

LOCATION OF MARKER IN TOWNSHIP (see illustration): <u>11E</u>	
Legal Description: <u>W. 1/4 COR.</u> Sec. <u>14</u> Twp. <u>16-S</u> Rng. <u>3-W</u>	
Survey Datum (if known): _____	North _____ East _____
Corner Status: <u>EXISTENT</u>	Monument Condition: <u>FOUND</u>
(Existent/Obliterated/Lost/Endangered)	(Found/Record/Set/Reset)
Monument Description: <u>CADAstral MARKER</u>	
REFERENCE MARKS AND MEASUREMENTS	
R1 <u>NAIL IN HEDGE TREE</u>	<u>25' 10" E.</u>
R2 <u>4" x 4" CONC. MON.</u>	<u>50' N.E.</u>
R3 <u>4" x 4" CONC. MON.</u>	<u>50' S.E.</u>
R4	

LOCATION OF MARKER IN TOWNSHIP (see illustration): <u>11E</u>	
Legal Description: _____ Sec. _____ Twp. _____ Rng. _____	
Survey Datum (if known): _____	North _____ East _____
Corner Status: _____	Monument Condition: _____
(Existent/Obliterated/Lost/Endangered)	(Found/Record/Set/Reset)
Monument Description: _____	
REFERENCE MARKS AND MEASUREMENTS	
R1	
R2	
R3	
R4	

MS-1024

APPENDIX A: SAMPLE COPIES OF LSRR

4-070
(September 1948)

Duplicate

003170

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD NOTES

OF THE DEPENDENT RESURVEY OF

THE EAST BOUNDARY, A PORTION OF THE WEST BOUNDARY

AND A PORTION OF THE SUBDIVISIONAL LINES OF

TOWNSHIP 16 SOUTH, RANGE 3 WEST

Of the SIXTH PRINCIPAL Meridian,
In the State of KANSAS

EXECUTED BY

George K. Holland, Transitman

[B006]

Under special instructions dated April 14, 1955, which provided
And supplemental special instructions September 26, 1955
for the surveys included under Group No. 11, approved May 3, 1955
and assignment instructions dated July 19, 1955, September 26, 1955

Survey commenced September 6, 1955

Survey completed October 6, 1955

U. S. GOVERNMENT PRINTING OFFICE 16-60770-1

APPENDIX A: SAMPLE COPIES OF LSRR

INDEX DIAGRAM

Township 16 South, Range 3 West

6	5	4	3 28	2 18	1 7
7	8	9	10 26	11 16	12 6
18	17	16	15 24	14 15	13 5
19	20	21	22 23	23 13	24 4
30	29	28 31	32 21	22 11	23 3
36	35	34	30 19	20 10	10 2
8 31 34	33 33	32 29	34 19	35 10	36 2

16-65770-1

APPENDIX A: SAMPLE COPIES OF LSRR

4-070 b

8

Dependent Resurvey of the East Boundary of T. 16 S., R. 3 W.

Chasing

The Closing corner of Townships 16 South, Ranges 2 and 3 West.

At the corner point

Set an iron post, 30 ins. long, 2 1/2 ins. diam., 10 ins. below the surface of the road, with brass cap mtd.

T155 R2W

S 31

S 1 S 6

R2W R2W

T 16 S

00

1955

from which

An iron post, 30 ins. long, 2 1/2 ins. diam., set 2 1/2 ins. in the ground, for a reference monument, bears S. 28° 49' E., 60.8 ft. dist., with brass cap mtd. RM 56 60.8 FT. 1955 and an arrow pointing to the corner.

An iron post, 30 ins. long, 2 1/2 ins. diam., set 2 1/2 ins. in the ground, for a reference monument, bears S. 27° 54' W., 54.4 ft. dist., with brass cap mtd. RM 51 54.4 FT. 1955 and an arrow pointing to the corner.

From this corner, the old Closing corner, monumented with an unmarked sandstone, 10x6x2 ins., set flush with the surface of the road, bears N. 0° 21' E., 0.000 chs. dist., from which:

A concrete reference monument, with cone shaped top, 4 ins. square, set with 8 ins. above ground, bears N. 65° 30' E., 50.0 ft. dist.

A concrete reference monument, with cone shaped top, 4 ins. square, set with 8 ins. above ground, bears N. 62° 51' W., 50.0 ft. dist.

Mark A M on sandstone and reset 4 ins. below the surface of the ground.

From this corner, the Standard corner of Townships 16 South, Ranges 2 and 3 West, bears S. 89° 49' W., 5.65 chs. dist., as described in the 1955 resurvey field notes of T. 16 S., R. 3 W.

Land, level.
Soil, sandy clay.
No timber.

Dependent Resurvey of a portion of the West Boundary of T. 16 S., R. 5 W.

Reestablishment of the survey executed by Myronia Parrow in 1864.

From the corner of Tps. 16 and 17 S., R. 3 and 4 W., monumented with a T-iron stake, set mtd. and witnessed as described in the 1955 resurvey field notes of T. 17 W., R. 3 W.

N. 0° 11' W., 1st. sec. 31 and 36.

Ascend over steep, hilly prairie land.

APPENDIX A: SAMPLE COPIES OF LSRR

4-078b

9

Dependent Resurvey of a portion of the West Boundary of T. 16 S., R. 3 W.

Chains	
28.00	S. edge of summit of Coronado Heights. Continuous over level land.
23.55	Replica of an old fort, bears E., approximately 3.00 chs. dist.
26.35	N. edge of summit of Coronado Heights. Descend over steep, hilly prairie land, along a fence line.
39.03	Selected point for the 1/2 witness corner bet. secs. 31 and 36.
	Set an iron post, 30 ins. long, 2 1/2 ins. diam., 25 ins. in the ground, with brass cap mkd.
	W.G.
	1/2
	S 36 1/2 S 31
	1955
	Set a cedar post, 7 ft. long, 3 ins. diam., alongside the corner monument.
39.98	True point for the 1/2 sec. cor. bet. secs. 31 and 36, determined by a property boundary fence line bearing E., and a hedgerow bearing W., and by a property boundary fence line bearing S. True point for corner falls in wash, unfavorable to permanency.
	N. 8° 21' W., beginning new measurement.
	Over rolling, broken prairie land.
22.00	Continue along fence line.
40.13	The corner of secs. 25, 30, 31 and 36, determined at the intersection of property boundary fence lines bearing N., S., E. and W. Corner stands under gate in fence.
	At the corner point
	Set a 1 in. T-iron stake, 24 ins. long, 6 ins. below the surface of the ground, with a cadmium plated cap mkd. U.S. Bureau of Land Management Survey Corner.
	From which
	An iron post, 30 ins. long, 2 1/2 ins. diam., set 24 ins. in the ground, for a reference monument, bears S. 81° 32' E., 23.8 ft. dist., with brass cap mkd. RM 311 23.8 FT. 1955 and an arrow pointing to the corner.
	An iron post, 30 ins. long, 2 1/2 ins. diam., set 24 ins. in the ground, for a reference monument, bears S. 5° 16' E., 28.3 ft. dist., with brass cap mkd. RM 311 28.3 FT. 1955 and an arrow pointing to the corner.
	Land, hilly and broken.
	Soil, sandy clay.
	Slight amount of timber, ash, oak, elm, on N. edge of Coronado Heights.

APPENDIX A: SAMPLE COPIES OF LSRR

LAND SURVEY REFERENCE REPORT
Department of Archives
Kansas State Historical Society
6425 SW Sixth Avenue, Topeka, KS 66615-1099
(785) 272-8681 Ext. 322 FAX (785) 272-8682



Surveyor Terry C. Mattison L.S. Reg. No. 1101
Company Saline County Engineers Office Job No. _____
Address 3424 Airport Road Telephone (785) 826-6527
Salina, Ks 67401 Date of Survey 4/12/02

This report is for Saline County, Kansas.

This report is filed as a (check only one):

- ☒ SURVEY REFERENCE REPORT (K.S.A. 58-2011a). ☐ NOTICE OF ENDANGERMENT ACTIVITY (K.S.A. 58-2011b).
There is a \$2.00 per corner filing fee which must accompany the Land Survey Reference Report.
- ☐ NOTICE OF COMPLETION OF ENDANGERMENT ACTIVITY AND REPORT OF RESTORATION (K.S.A. 58-2011c).
This may only be filed after a prior NOTICE OF ENDANGERMENT ACTIVITY. There is no filing fee.
Endangerment report filed _____

LOCATION CODE OF MARKER IN TOWNSHIP (see illustration on back): 01R
Legal Description Northwest Section Corner Section 30 Township 16 South Range: 3 West
Survey Datum (if known) _____ North: _____ East: _____
Corner Status Prior to Survey: ☐ Existent ☒ Obliterated ☐ Lost ☐ Endangered
Monument Condition: ☐ Found ☒ Set ☐ Reset ☐ Found Record
Monument Description: Set 5/8" x 24" rebar with aluminum cap stamped "SALINE COUNTY SURVEYOR"

REFERENCE MARKS AND MEASUREMENTS: (Please, no symbols or abbreviations.)

NOTE: ALL MEASUREMENTS ARE ☐ HORIZONTAL ☒ SLOPED UNLESS NOTED OTHERWISE

R1 Nail in power pole	28.55' SE
R2 Nail in power pole	33.2' SW
R3 60d spike in top of brace post	43.65' SE
R4 60d spike in top of brace post	23.05' NNE
R5 60d spike & washer in SW side of guy post	34.7' NW
R6 Centerline/Street sign post	34.95' SE


METHOD OF RECOVERY OR ESTABLISHMENT: (use back of form for sketch or additional information)

Found 1/2" bar	8' NW
60d spike in top of fence post	42.53' SW

SURVEYOR'S CERTIFICATE:

This is to certify that I, Terry C. Mattison, have found evidence of the corner hereon described and that the statements contained hereon correctly represent the evidence, corner, monuments and accessories for the corner.

Signed Terry C. Mattison Date 4/17/02

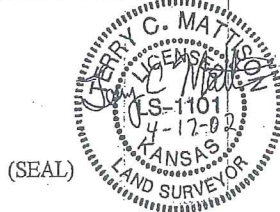

APPENDIX A: SAMPLE COPIES OF LSRR

LAND SURVEY REFERENCE REPORT

Department of Archives

Kansas State Historical Society

6425 SW Sixth Avenue, Topeka, KS 66615-1099

(785) 272-8681 Ext. 322 FAX (785) 272-8682

FOR OFFICIAL USE ONLY

FEB 0 3 2004
026482
FEDERAL ARCHIVES
STATE ARCHIVIST

Land Surveyor: William B. Heller L.S. Reg. Number: 1202
Company: Heller Boundary Surveys Project Number: _____
Street Address: 734 N. 15th St. Telephone Number: 1-785-227-2759
City, State: Lindsborg, KS Date of Survey: 1-10-2004
Zip Code: 67456 County of Survey: Saline

This report is filed as a (check only one):

- ☒ SURVEY REFERENCE REPORT (K.S.A. 58-2011a). ☐ NOTICE OF ENDANGERMENT ACTIVITY (K.S.A. 58-2011b).
There is a \$2.00 per corner filing fee, which must accompany the Land Survey Reference Report.
☐ NOTICE OF COMPLETION OF ENDANGERMENT ACTIVITY AND REPORT OF RESTORATION (K.S.A. 58-2011c).
This may only be filed after filing a prior NOTICE OF ENDANGERMENT ACTIVITY. There is no filing fee.
Endangerment report was filed on _____

LOCATION CODE OF MARKER IN TOWNSHIP (see illustration on back): 13V

Legal Description: S.W. Corner Section: 27 Township: 16S Range: 4W

Survey Datum (if known): _____ North: _____ East: _____

Corner Status Prior to Survey: ☐ Existent ☐ Obliterated ☒ Lost ☐ Endangered

Monument Condition: ☐ Found ☐ Set ☒ Reset ☐ Found Record

Detailed Monument Description: 1/2" x 24" rebar with plastic I.D. cap
0.5' deep in travel way public road intersection

REFERENCE MARKS AND MEASUREMENTS: (Please, no symbols or abbreviations.)

NOTE: ALL MEASUREMENTS ARE ☐ HORIZONTAL ☒ SLOPED UNLESS NOTED OTHERWISE.

R1 31.4' N.W. spike top corner fence post

R2 40.4' W.N.W. spike top brace fence post

R3 36.4' S.S.W. spike top brace fence post

R4 30.1' S.E. spike in N.E. face power pole

R5 56.9' S.S.W. spike in S.E. face power pole

R6 22' S. line of E-W. timber cross road culvert

R7 8' N. centerline travel way E-W. public road

R8 5' W. centerline travel way N-S. public road

DETAILED METHOD OF RECOVERY OR ESTABLISHMENT: Online and proportionate
between the W. 1/4 corner Sec. 34, T16S-R4W and the N.W. corner Sec. 27,
T16S-R4W

SURVEYOR'S CERTIFICATE:

This is to certify that I, William B. Heller have found evidence of the corner hereon described and that the statements contained hereon correctly represent the evidence, corner, monuments, and accessories for the corner.



The original signature and date shall be across the Land Surveyor's Professional seal.

THIS BLANK FORM MAY BE PHOTOCOPIED

APPENDIX A: SAMPLE COPIES OF LSRR

THIS SPACE FOR SKETCH OR ADDITIONAL INFORMATION.

R.9. 19' E line of hedge row S. (500' distant)

IDENTIFYING A MARKER

To identify the location of a marker in a township, use the following standard alpha-numerical grid to designate an identifier for a given section, corner or intersection.

For example: The southwest corner of Section 26 would be designated by the identifier 17V (this is the LOCATION CODE OF MARKER IN TOWNSHIP to be entered in the three boxes on the front side of this sheet).

Sec 6	Sec 5	Sec 4	Sec 3	Sec 2	Sec 1	A
						C
Sec 7	Sec 8	Sec 9	Sec 10	Sec 11	Sec 12	E
						G
Sec 18	Sec 17	Sec 16	Sec 15	Sec 14	Sec 13	J
						L
Sec 19	Sec 20	Sec 21	Sec 22	Sec 23	Sec 24	N
						P
Sec 30	Sec 29	Sec 28	Sec 27	Sec 26	Sec 25	R
						T
Sec 31	Sec 32	Sec 33	Sec 34	Sec 35	Sec 36	V
						X
						Z

1000000 17V 74433

1000000 17V 74433

1 3 5 7 9 11 13 15 17 19 21 23 25